



To: All RedMax Distributors and Dealers
Subject: GZ3500T Carburetor

PRODUCT MODEL	SERIAL NUMBER
GZ3500T	Serial Number 8XXXXXXXX

Problem:The Air Valve could become misaligned at idle preventing advancement of the throttle.

Solution: Install alignment bracket on the air valve. This bracket will keep the Air Valve linkage aligned with the Throttle Valve linkage when the Throttle lever is depressed.

Additional Note: This Bulletin DOES NOT APPLY to units with Serial Number 9XXXXXXXX and up.

Important Installation Information: It is NOT necessary to remove the Carburetor bolts or Air Horn to install this bracket.

1. Remove the Air Box Cover, and Air Filter
2. Remove Screw from Carburetor
3. Lay Bracket into place as shown

4. Reinstall screw and tighten securely
5. Reinstall the Air Box Cover, and Air Filter

